

PAINTING SPECS

73

1. Clean with Turco W. O. #1
2. Thinned out zinc chromate
3. Laquer primer - surfacer (2 coats)
4. Sand with #150 - 180 production or open coat carbide paper.
5. 2 coats primer surfacer.
6. Sand with 180-240 production or carbide paper.
7. 1 coat surfacer followed with a light foggy coat of some contrasting color.
8. Sand with 240 paper.
9. Touch up any bad spots with surfacer and sand.
10. Three coats color laquer.
11. Sand with 320 - 400 wet or dry paper.
12. Touch up bad spots and sand.
13. One thinned flow coat color.
14. Follow up as soon as possible with one flow coat thinner.
15. Rub
16. Wax

- 1 Gal. Turco W.O. #1
- 1 Gal. Zinc chromate
- 2 Gal. Zinc chromate thinner
- 2 Gal. Laquer primer surfacer
- $\frac{1}{2}$ Gal. Laquer surfacer of a color to contrast with above
- 10 Gal. Laquer thinner
- 100 Sheets #150 or 180 Production or open coat carbide paper
- 100 Sheets #240 ditto
- 100 Sheets #320 or 400 wet or dry paper.